 


## **WORK INSTRUCTIONS**



 
STEP 1: CUT CABLE (M0530-2408) AS SINGLE TO LENGTH INDICATED IN THE BOM.



STEP 2: STRIP THE CABLE JACKET 1" MANUALLY USING THE HAND STRIPPERS AND REMOVE JACKET AND FILLERS.



STEP 3: ARRANGE THE WIRES IN ORDER ACCORDING TO THE COLOR CODE. TRIM THE WIRES ENDS AT 90° TO APPROX 9/16" LONG



STEP 4: INSERT WIRES INTO RJ45 CONNECTOR (S0405-0037) PER COLOR CODE AND CRIMP USING THE AMP MODULAR CRIMPER WITH BLACK DOT DIE.

STEP 5: TEST FOR CONTINUITY AND PROPER COLOR CODE

STEP 6:LABEL TO CABLCON STANDARDS USING STANDARD LABELS (THT-75-427-3).

	01	REPLACE CONNECTOR (S0405-0001) WITH (S0405-0037)	5/24	LV	SF
	00	ORIGINAL	3/24	LV	SF
	REV	DESCRIPTION	DATE	DR	APR
_		REVISION HISTORY			



359 Robbins Dr. Troy, Michigan 48083 (800) 969-9220

ALPHA CHARACTER IN REVISION BLOCK REPRESENTS CORRECTION TO DRAWING.
A NUMBER WILL REPRESENT A PHYSICAL CHANGE
THE INFORMATION CONTAINED IN THIS DRAWING IS THE SOLE
PROPERTY OF CABL CON INC. ANY REPROPICITION IN PART OR WHO!

DATE	DRAWN BY	TITLE
3/7/24	LV	T4640-0001
SHT	CODE	RJ45 Patch Cord Flat Cable
2 of 2	С	NJ45 Fatch Cold Hat Cable