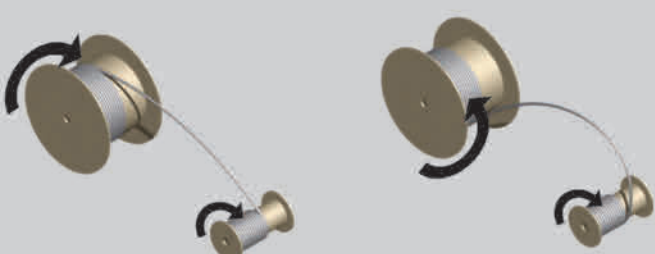
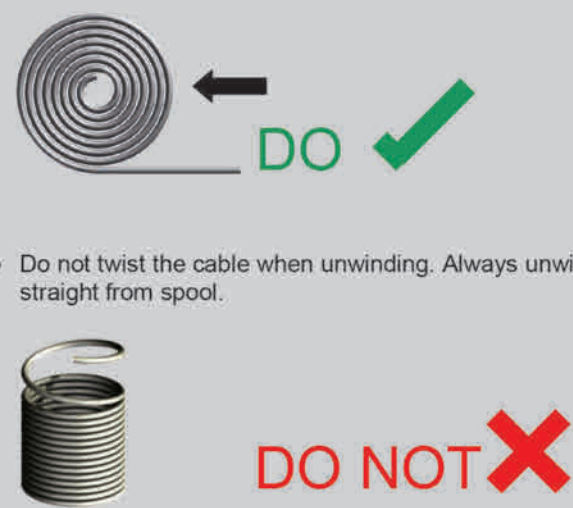
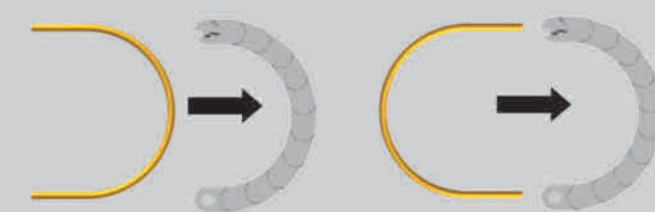
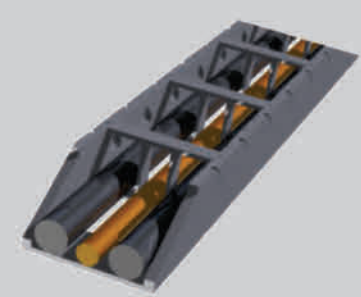
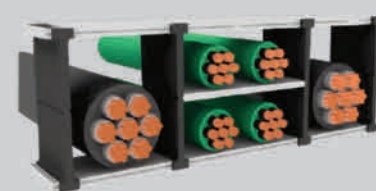
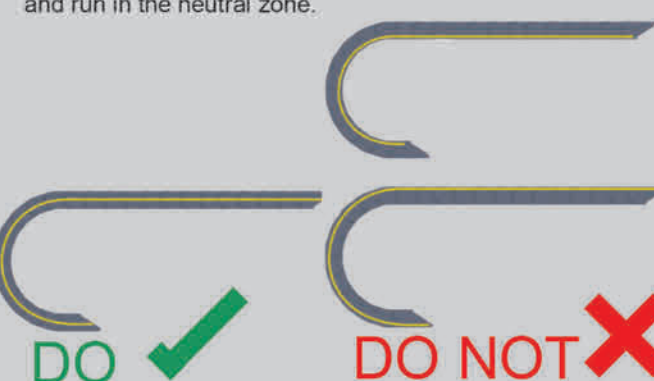


Handling & Installation LUTZE SUPERFLEX® – Quick Overview

2. Correct Handling of LUTZE SUPERFLEX® Cables

| | |
|---|---|
| <ul style="list-style-type: none"> When unreeling the cable, do not change the bend direction. The cable has to go on the new reel in the same direction it came off the reel. Low and equal tensile force during spooling!  <p>DO ✓ DO NOT ✗</p> | <ul style="list-style-type: none"> Ring put ups require careful uncoiling by rolling the ring upright over the floor. Do not twist the cable when unwinding. Always unwind straight from spool.  <p>DO ✓ DO NOT ✗</p> |
|---|---|

3. Correct Installation of LUTZE SUPERFLEX® Cables

| | |
|---|--|
| <ul style="list-style-type: none"> Cable retains bend from reel. Do not flex against original bend or relax cable for 24 hrs by laying it flat.  <p>DO ✓ DO NOT ✗</p> | <ul style="list-style-type: none"> Try to ensure balanced weight distribution. If you have more than one heavy cable, we recommend installing the heavy cables evenly to each side of the track.  |
| <ul style="list-style-type: none"> Use dividers horizontally and vertically to separate the track into separate cavities. Install just one cable per separated cavity. If absolutely necessary, two small or a small and a big cable can share a cavity.  | <ul style="list-style-type: none"> Observe the minimum bending radius for optimum performance. Make sure that all cables are length-adjusted and run in the neutral zone.  <p>DO ✓ DO NOT ✗</p> |

For further information please visit: www.lutze.com/superflex