

T-Shapes

• Helashrink 1200 Series, Offset


This style provides strain relief, sealing and mechanical protection where a cable transition is required on the harness, it is recommended that an adhesive be used if environmental sealing is required.



1217-1 supplied / fully recovered.



a: Expanded form (supplied)

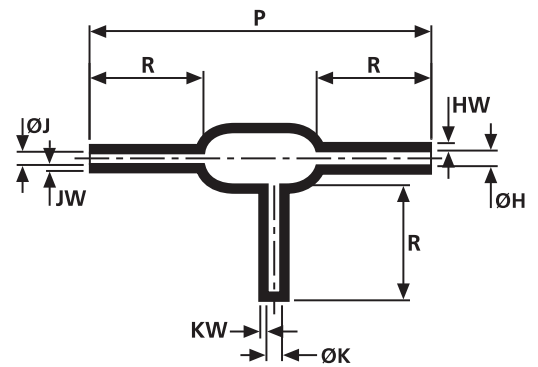

b: Fully recovered form (after heating)

Sizes and Type Table											
Type	ØH min. a	ØH max. b	ØJ min. a	ØJ max. b	ØK min. a	ØK max. b	P ± 10%	R ± 10%	HW ± 20%	JW ± 20%	KW ± 20%
1217-1	10.0	2.6	6.0	2.2	6.0	2.6	57.0	19.0	1.0	1.0	1.0
1222-1	31.0	15.2	18.0	8.9	25.0	15.0	92.0	52.0	2.3	1.8	2.3
1223-1	29.5	16.3	9.6	5.3	29.5	16.3	93.2	56.6	2.5	1.8	2.5

All dimensions in mm. Subject to technical changes.

Combinations "On request"					
Adhesive	Material				
	B7	G	J	H	L
WM250	√	√	√	√	-
W8	√	√	√	√	-
W24	√	√	√	√	√
V9500	√	√	√	√	-
HMT200A	√	√	√	√	-
W21	-	-	-	√	-
Without Adhesive	√	√	√	√	√

Standard combinations	
Article-No.	Type
412-17003	1217-1-G
412-22002	1222-1-G
412-23003	1223-1-HP